



BT1


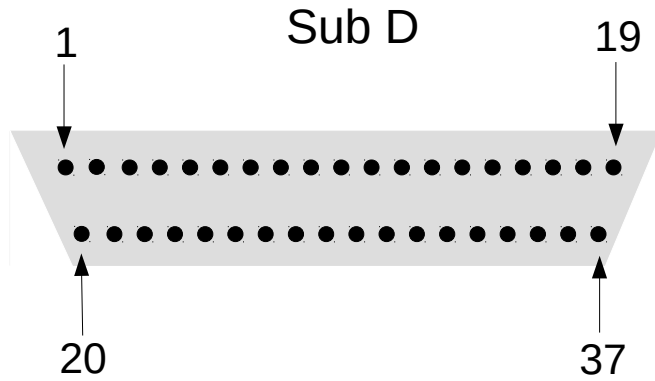


No pin	Désignation (V)	No sub D	No pin sub D
1	masse		
2	+2.5 (+)	1	23, 4, 5
3	-2.5 (-)	2	33, 14, 15
4	-2.5 (+)	2	16, 34, 35
5	+3.3 (-)	3	33, 14, 15
6	+3.3 (+)	3	16, 34, 35
7	+2.5 (-)	1	6, 24, 25
8	+2.5 (-)	1	22
9	+2.5 (+)	1	3
10	masse		
11	-2.5 (-)	2	13
12	-2.5 (+)	2	32
13	+10 (-)	4	32
14	+10 (+)	4	13
15	+10 (+)	4	33, 14, 15
16	+10 (-)	4	16, 34, 35
17	+3.3 (-)	3	32
18	+3.3 (+)	3	13

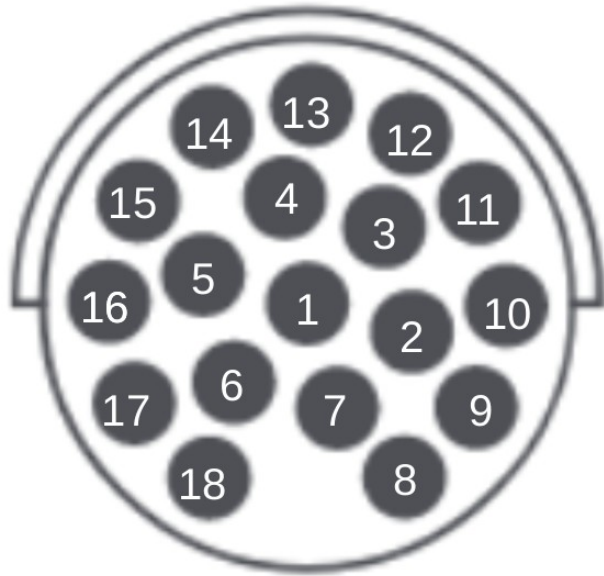

Prise BT


BT2

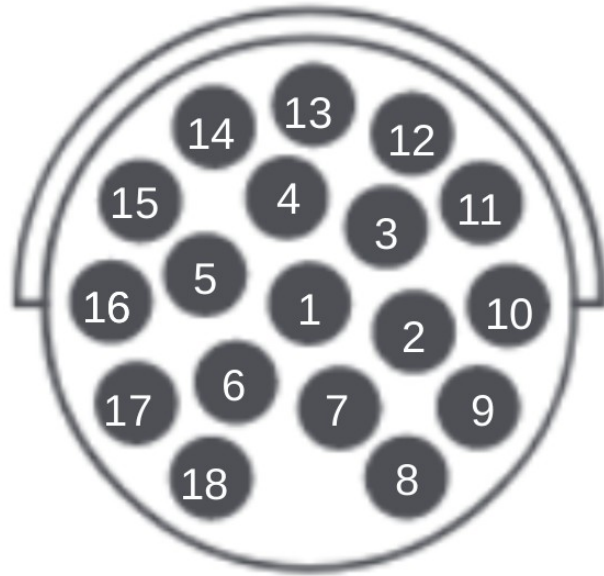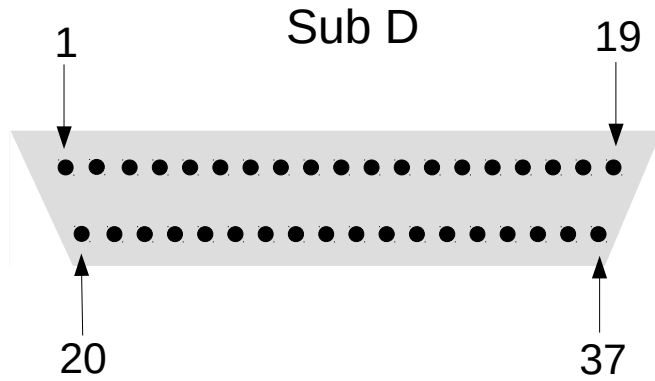


Prise BT

No pin	Désignation (V)	No sub D	No pin sub D
1	masse		
2	+2.5 (+)	1	28, 9, 10
3	-2.5 (-)	2	28, 9, 10
4	-2.5 (+)	2	11, 29, 30
5	+3.3 (-)	3	33, 14, 15
6	+3.3 (+)	3	16, 34, 35
7	+2.5 (-)	1	11, 29, 30
8	+2.5 (-)	1	27
9	+2.5 (+)	1	8
10	masse		
11	-2.5 (-)	2	7
12	-2.5 (+)	2	8
13	nc		
14	nc		
15	+10 (+)	4	33, 14, 15
16	+10 (-)	4	16, 34, 35
17	nc		
18	nc		

BT3


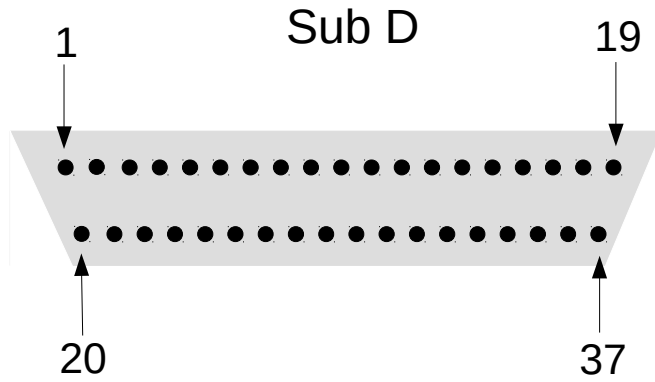


No pin	Désignation (V)	No sub D	No pin sub D
1	masse		
2	+2.5 (+)	1	33, 14, 15
3	-2.5 (-)	2	23, 4, 5
4	-2.5 (+)	2	6, 24, 25
5	+3.3 (-)	3	33, 14, 15
6	+3.3 (+)	3	16, 34, 35
7	+2.5 (-)	1	16, 34, 35
8	+2.5 (-)	1	22
9	+2.5 (+)	1	13
10	masse		
11	-2.5 (-)	2	22
12	-2.5 (+)	2	3
13	nc		
14	nc		
15	+10 (+)	4	33, 14, 15
16	+10 (-)	4	16, 34, 35
17	nc		
18	nc		

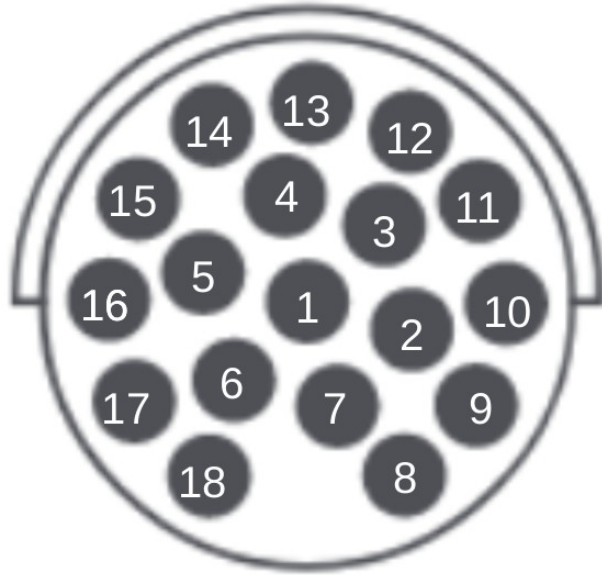

Prise BT



BT4

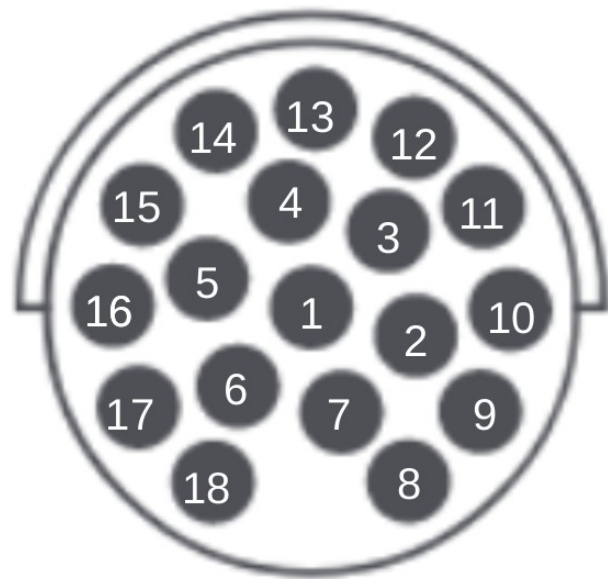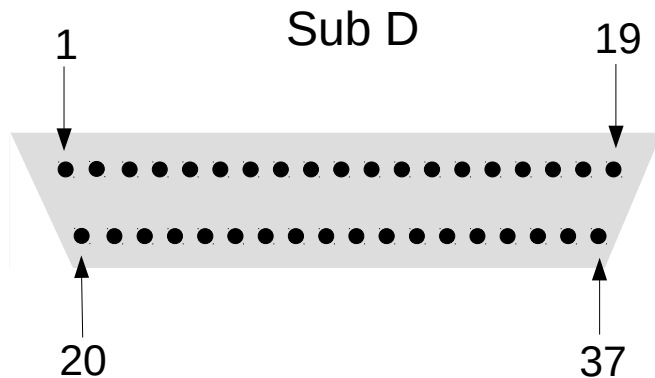

Prise BT

No pin	Désignation (V)	No sub D	No pin sub D
1	masse		
2	+2.5 (+)	5	23, 4, 5
3	-2.5 (-)	6	23, 4, 5
4	-2.5 (+)	6	6, 24, 25
5	+3.3 (-)	3	33, 14, 15
6	+3.3 (+)	3	16, 34, 35
7	+2.5 (-)	5	6, 24, 25
8	+2.5 (-)	5	22
9	+2.5 (+)	5	3
10	masse		
11	-2.5 (-)	6	3
12	-2.5 (+)	6	22
13	nc		
14	nc		
15	+10 (+)	4	33, 14, 15
16	+10 (-)	4	16, 34, 35
17	nc		
18	nc		


BT5

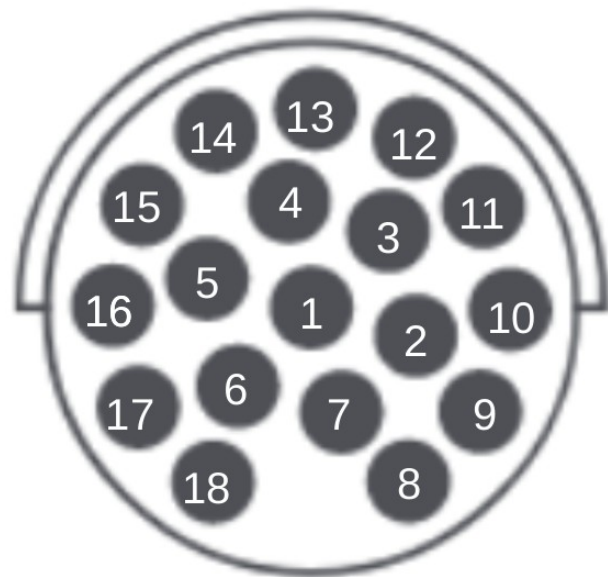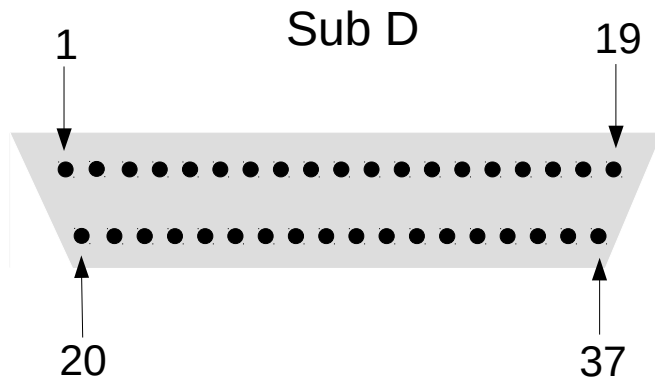


Prise BT

No pin	Désignation (V)	No sub D	No pin sub D
1	masse		
2	+2.5 (+)	5	28, 9, 10
3	-2.5 (-)	6	28, 9, 10
4	-2.5 (+)	6	11, 29, 30
5	+3.3 (-)	3	33, 14, 15
6	+3.3 (+)	3	16, 34, 35
7	+2.5 (-)	5	11, 29, 30
8	+2.5 (-)	5	27
9	+2.5 (+)	5	8
10	masse		
11	-2.5 (-)	6	8
12	-2.5 (+)	6	27
13	+10 (-)	4	32
14	+10 (+)	4	13
15	+10 (+)	4	33, 14, 15
16	+10 (-)	4	16, 34, 35
17	nc		
18	nc		

BT6


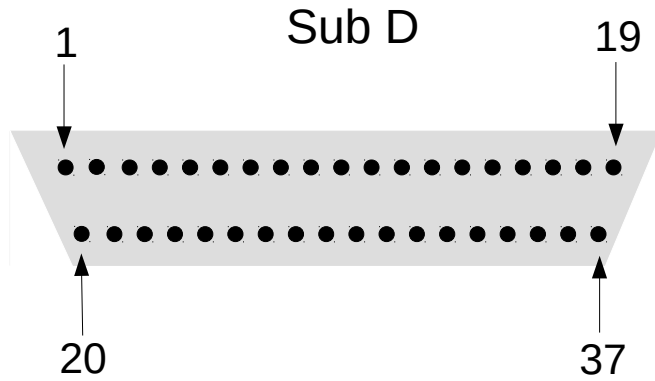


No pin	Désignation (V)	No sub D	No pin sub D
1	masse		
2	+2.5 (+)	5	33, 14, 15
3	-2.5 (-)	6	33, 14, 15
4	-2.5 (+)	6	16, 34, 35
5	+3.3 (-)	3	33, 14, 15
6	+3.3 (+)	3	16, 34, 35
7	+2.5 (-)	5	16, 34, 35
8	+2.5 (-)	5	32
9	+2.5 (+)	5	13
10	masse		
11	-2.5 (-)	6	13
12	-2.5 (+)	6	32
13	+10 (-)	4	32
14	+10 (+)	4	13
15	+10 (+)	4	33, 14, 15
16	+10 (-)	4	16, 34, 35
17	nc		
18	nc		


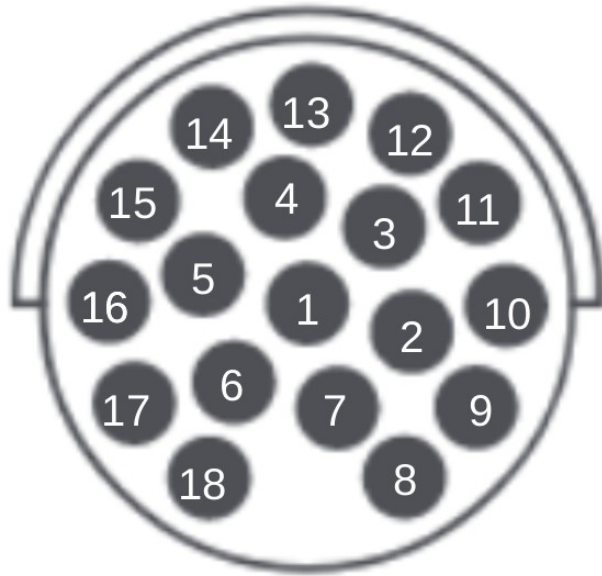


Prise BT



MG1

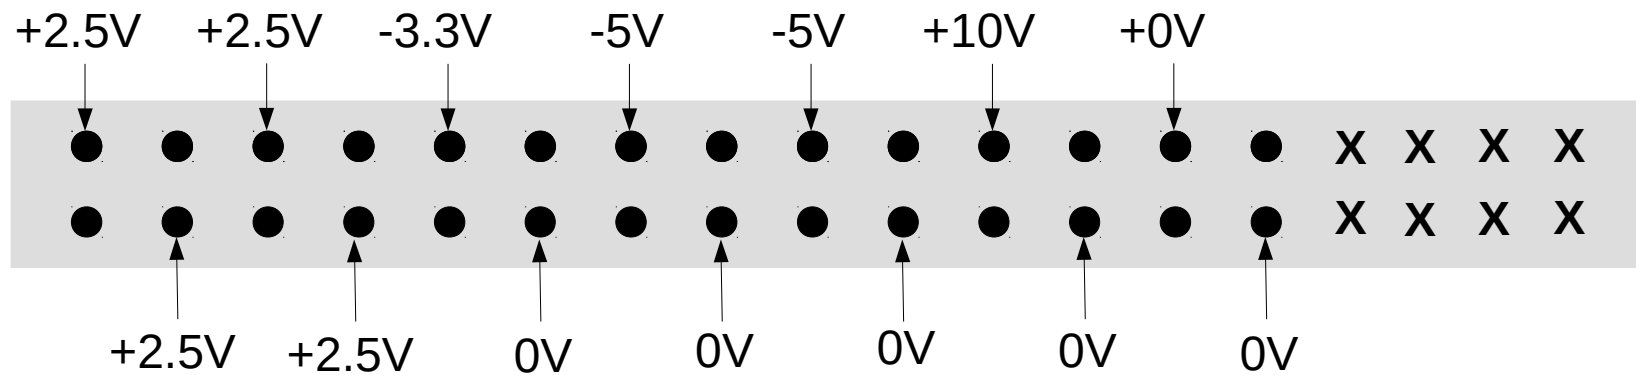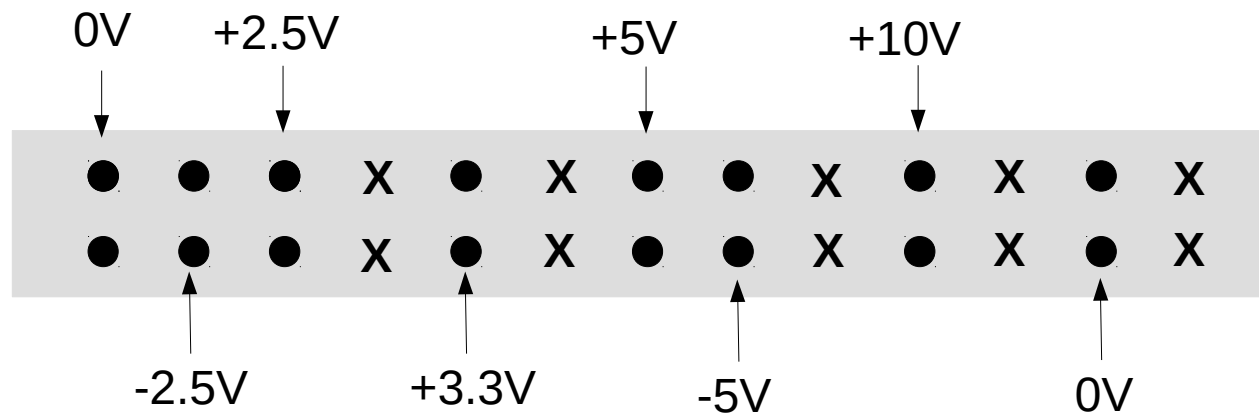


MG3

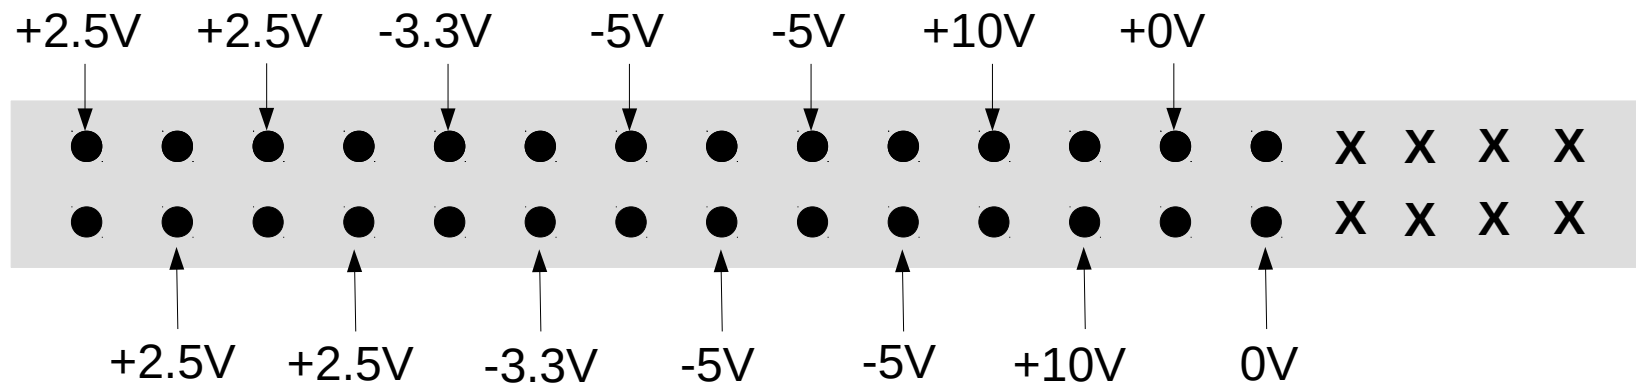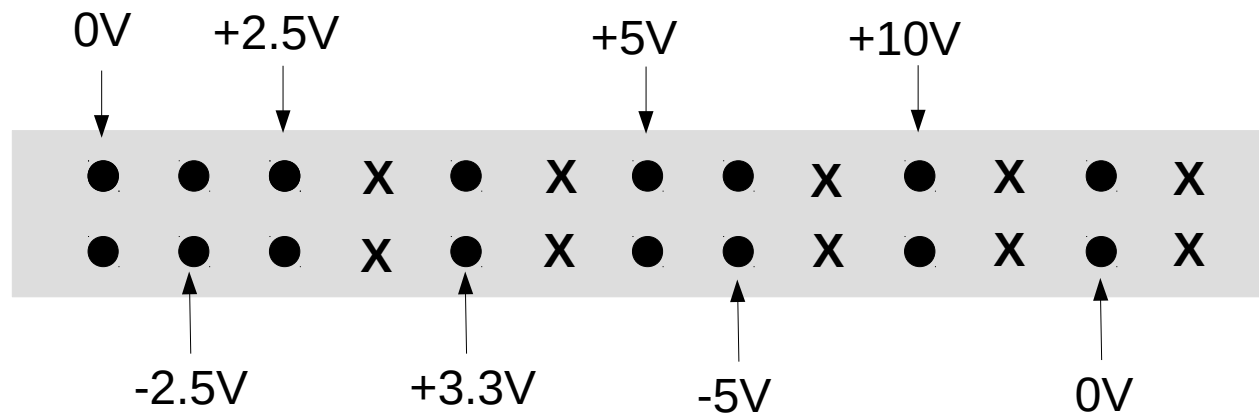


MG4

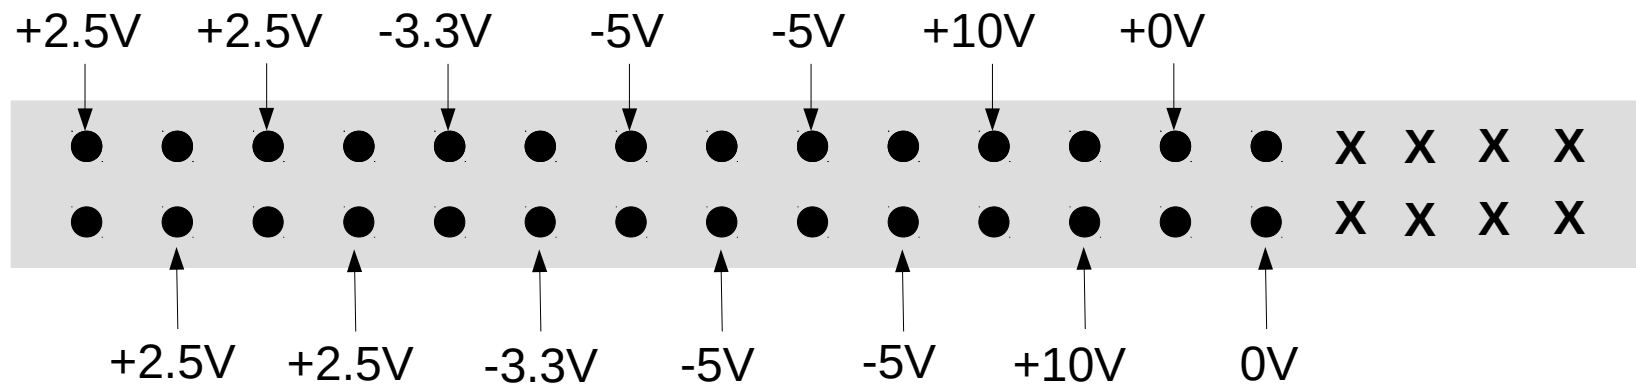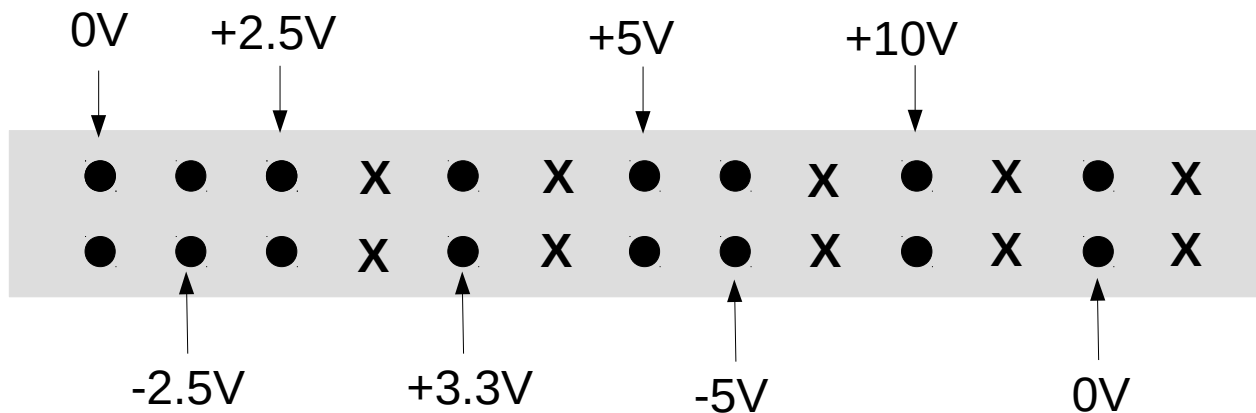



BT1 NEW BOX

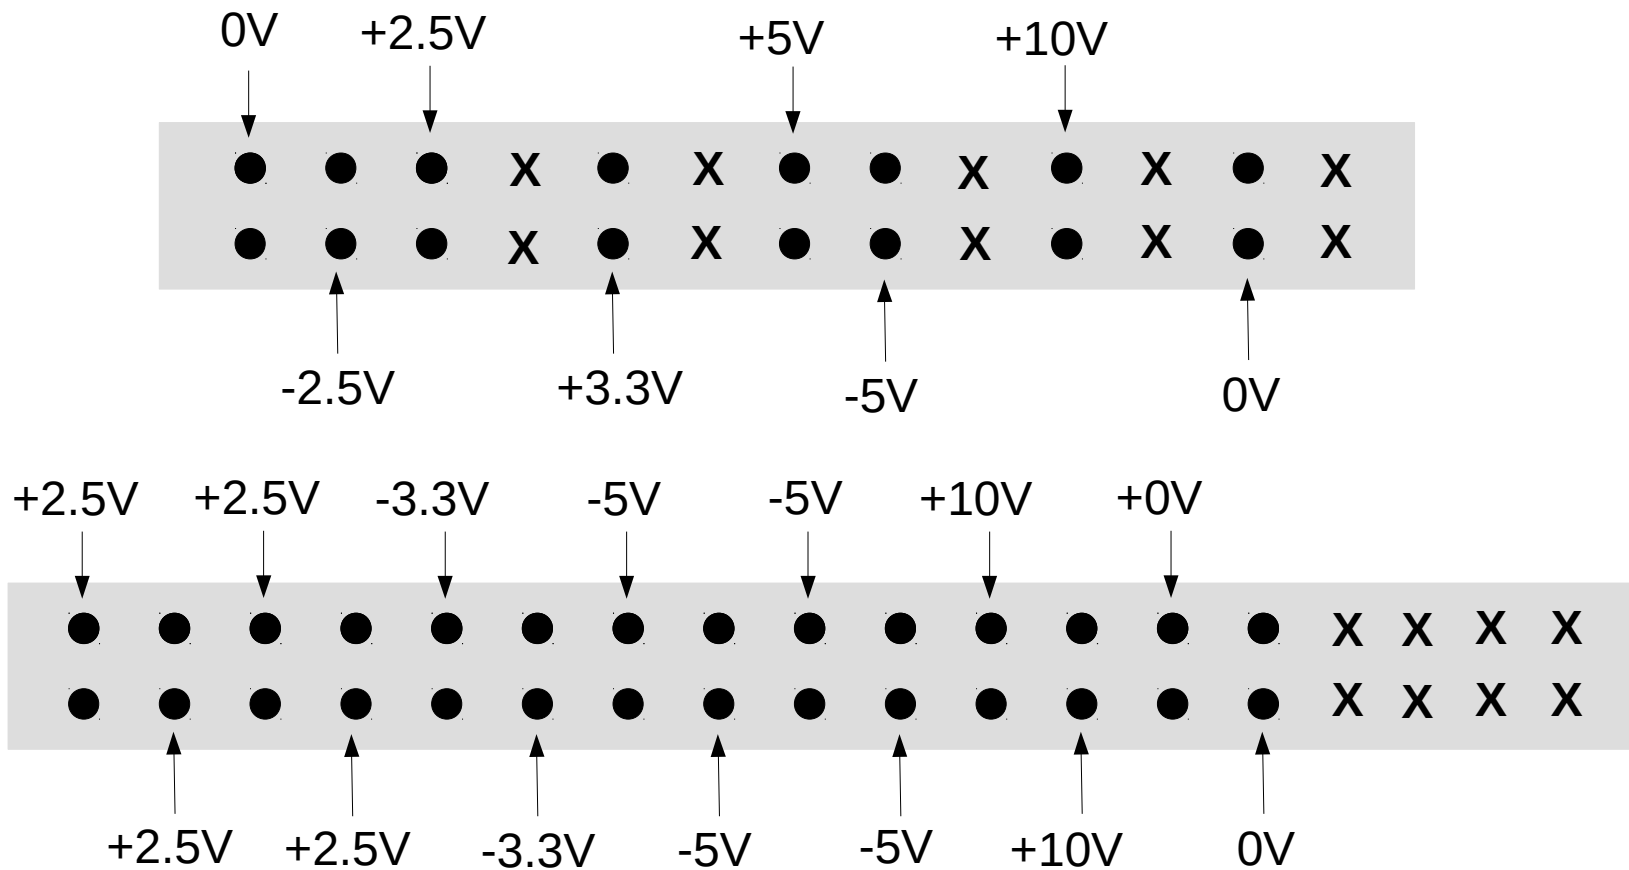



BT2 NEW BOX

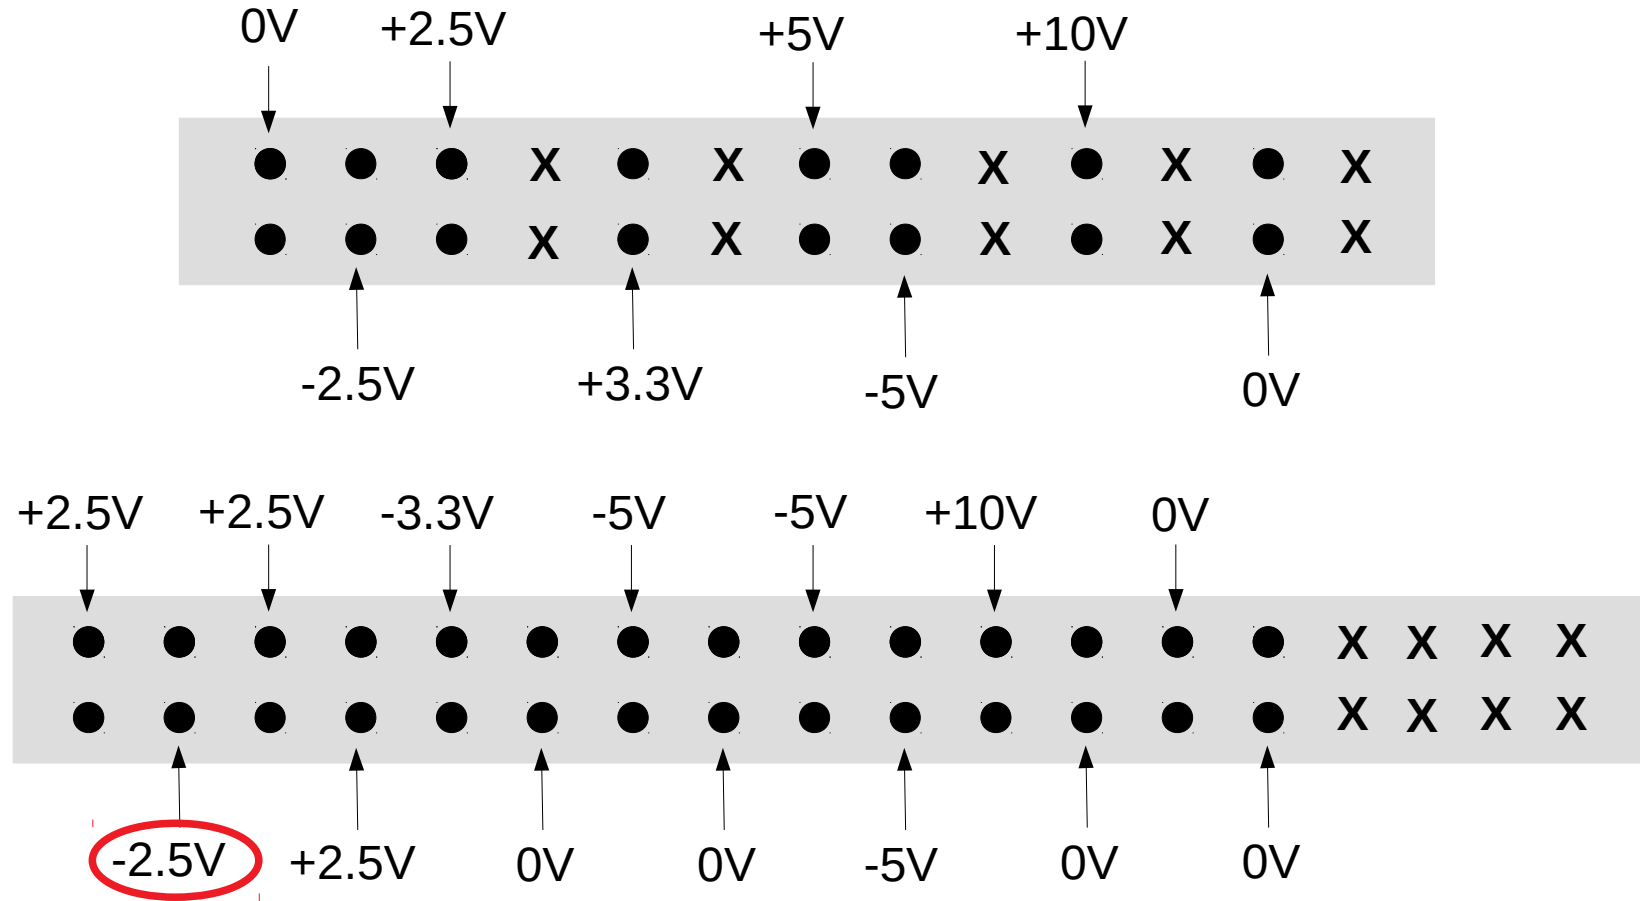



BT3 NEW BOX

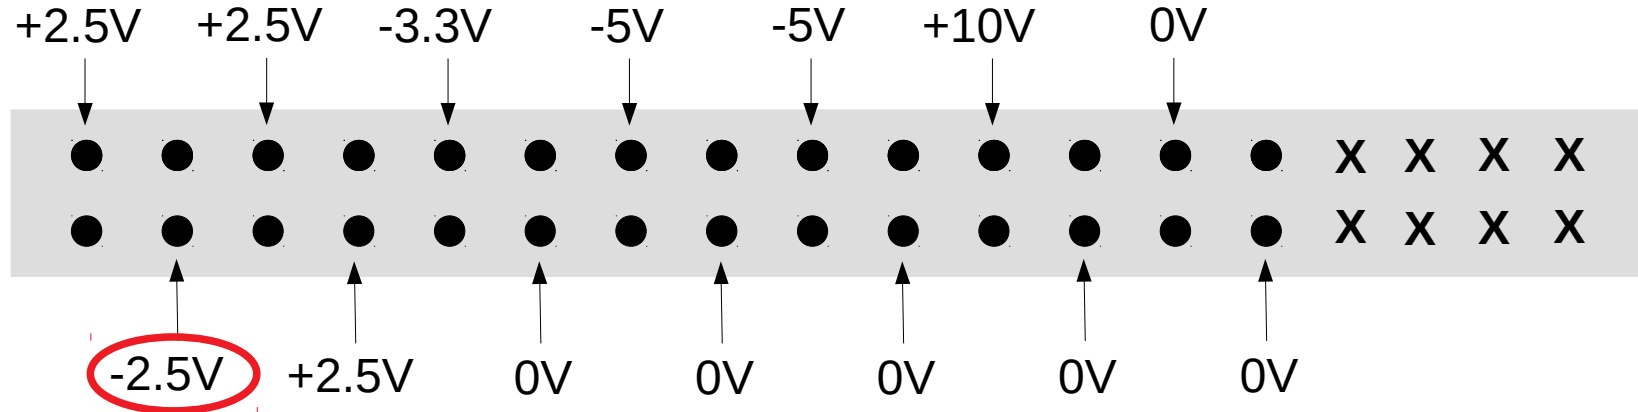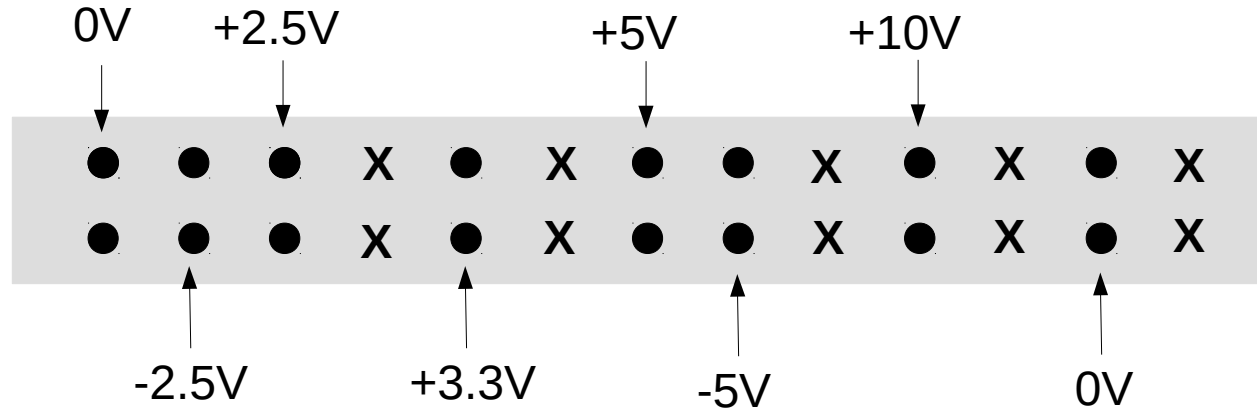

BT4 NEW BOX

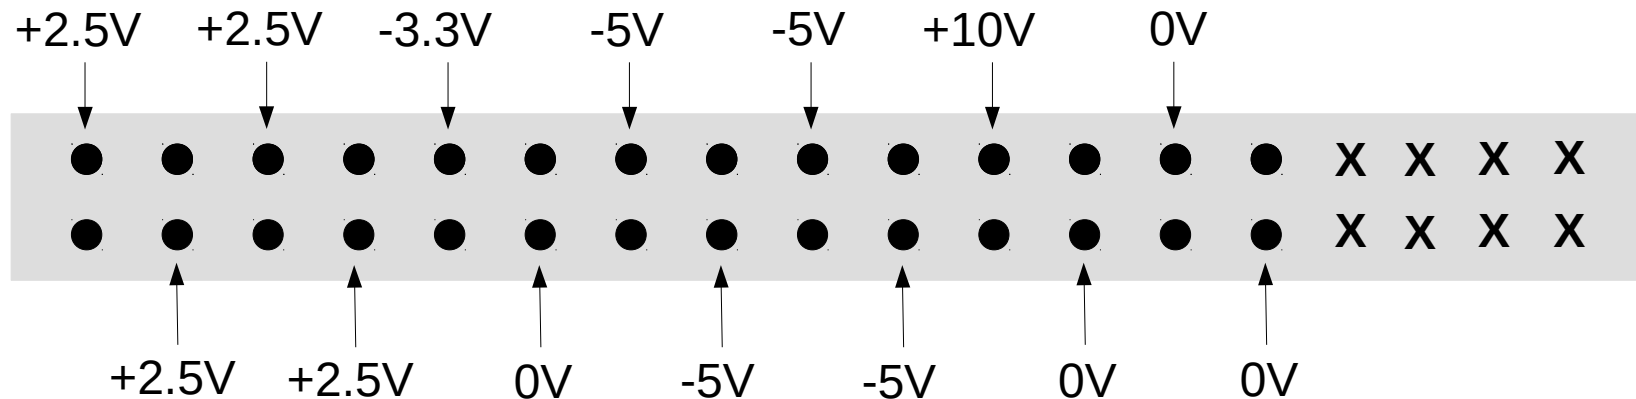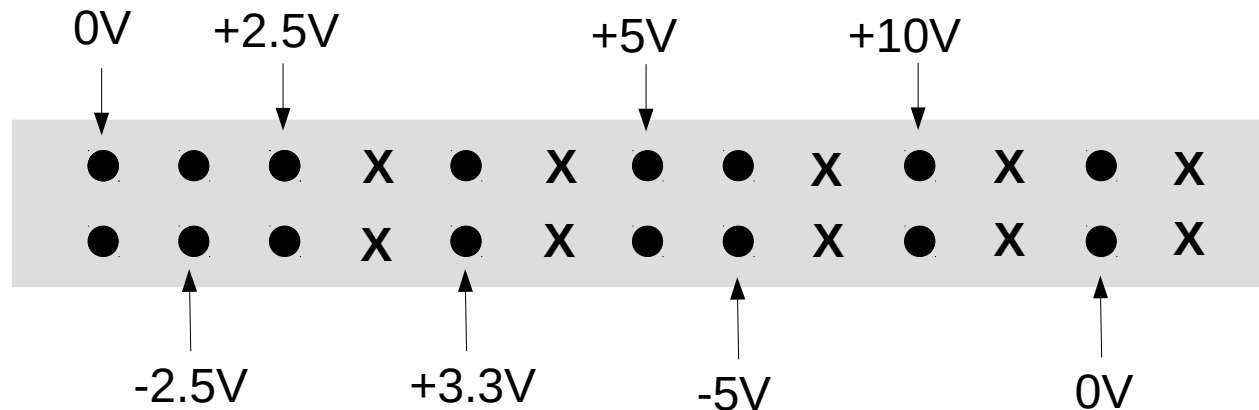

BT5 NEW BOX

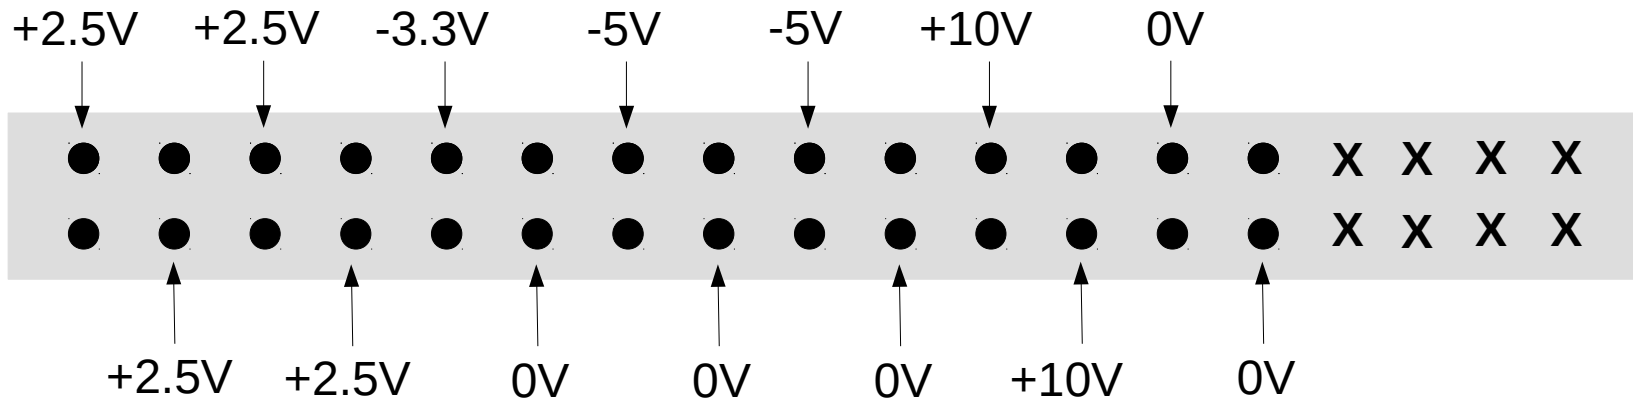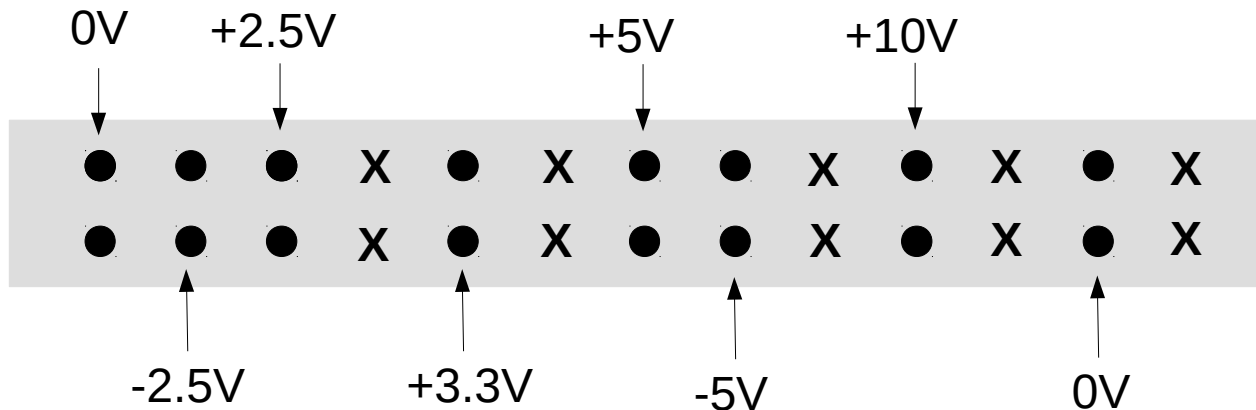

BT6 NEW BOX

